



REFLOW

FEATURES

- High speed response realizes effective countermeasure for acute ESD.
- No polarity makes effective countermeasure for both directions with one component.
- High resistance to static electricity keeps high performance after static electricity applied.
- 1005 (0402) case size contributes to designing for high density mounting device.

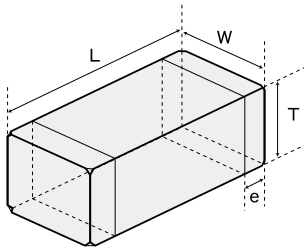
APPLICATIONS

- ESD (Electric static discharge) protection.

ORDERING CODE

| | | | | | | | | | | | | | | | | | |
|--|---|---|----------------------------------|---|---|--|---|--|---|---------------------|---|--|---|----------------|---|--------------------------------------|--|
| V | R | △ | 1 | 0 | 0 | 5 | A | A | A | 1 | 2 | 0 | — | T | △ | △ | |
| 1 Type | | | 2 External Dimensions (L×W) (mm) | | | 3 Withstanding Surge Current | | 4 Capacitance | | 5 Special code | | 6 Varistor voltage [V] | | 7 Packaging | | 8 Internal code | |
| VR△ MULTILAYER CHIP VARISTORS △=Blank space | | | 1005 (0402) 1.0×0.5 | | | A Standard products B~ Special products | | A Standard products B~ Special products | | A Standard products | | 6R8 6.8 080 8×10 ⁰ 120 12×10 ⁰ 180 18×10 ⁰ 270 27×10 ⁰ | | —T Tape & Reel | | △ Standard products △=Blank space | |

EXTERNAL DIMENSIONS/STANDARD QUANTITY



| Type | L | W | T | e | Standard Quantity [pcs] Taping |
|-------------|---------------------------|---------------------------|---------------------------|----------------------------|-----------------------------------|
| 1005 (0402) | 1.0±0.05 (0.039±0.002) | 0.5±0.05 (0.020±0.002) | 0.5±0.05 (0.020±0.002) | 0.25±0.10 (0.010±0.004) | 10000 |

Unit : mm (inch)

PART NUMBERS

- 1005 TYPE (Operating Temperature : -55~+125°C)

| Ordering Code | EHS (Environmental Hazardous Substances) | Varistor Voltage V1mA (V) | Varistor voltage tolerance | Rated Voltage DC (V) | Clamping Voltage V0.1A (V) | ESD Peak Voltage 150pF 330Ω contact discharge (kV) | Peak current 8/20μsec. (A) | Capacitance (reference value) 1kHz 1Vrms (pF) |
|---------------|---|------------------------------|-------------------------------|-------------------------|----------------------------------|---|-------------------------------|---|
| VR1005BBA270 | RoHS | 27 | ±20% | 15 | 46 | 15 | 10 | 80 |
| VR1005AAA270 | RoHS | 27 | | 15 | 46 | | 5 | 40 |
| VR1005CCA270 | RoHS | 27 | | 15 | 46 | | 1 | 15 |
| VR1005AAA180 | RoHS | 18 | | 10 | 32 | | 10 | 140 |
| VR1005AAA120 | RoHS | 12 | | 7.5 | 22 | | 5 | 130 |
| VR1005BBA080 | RoHS | 8 | | 5.5 | 15 | | 25 | 650 |
| VR1005DDA080 | RoHS | 8 | ±30% | 5.5 | 15 | 8 | 20 | 480 |
| VR1005AAA080 | RoHS | 8 | | 5.5 | 15 | | 3 | 100 |
| VR1005CCA080 | RoHS | 8 | | 4.5 | 17 | | 1 | 33 |
| VR1005AAA6R8 | RoHS | 6.8 | | 3.5 | 15 | | 3 | 100 |

* This catalog contains the typical specification only due to the limitation of space. When you consider the purchase of our products, please check our specification. For details of each product (characteristics graph, reliability information, precautions for use, and so on), see our Web site (<http://www.ty-top.com/>) or CD catalogs.

MULTILAYER CHIP VARISTORS



REFLOW

FEATURES

- High speed response realizes effective countermeasure for acute ESD.
- No polarity makes effective countermeasure for both directions with one component.
- High resistance to static electricity keeps high performance after static electricity applied.
- 0603 (0201) case size contributes to designing for high density mounting device.


APPLICATIONS

- ESD (Electric static discharge) protection.

ORDERING CODE

| | | | | | | | | | | | | | | | | | |
|--|---|---|---|---|--------------------------------------|---|--|---|--|---|--|---|----------------|---|--------------------------------------|---|---|
| V | R | △ | 0 | 6 | 3 | △ | 3 | 3 | 0 | A | 1 | 2 | 0 | — | T | △ | △ |
| 1 Type | | | 2 External Dimensions (EIA) (L×W) [mm] | | 3 Series name | | 4 Capacitance[pF] | | 5 Special code | | 6 Varistor voltage[V] | | 7 Packaging | | 8 Internal code | | |
| VR△ MULTILAYER CHIP VARISTORS △=Blank space | | | 063 (0201) 0.6×0.3 | | △ Standard products △=Blank space | | 330 33×10 ⁰ 101 10×10 ¹ | | A Standard products B~ Special products | | 6R8 6.8 080 8×10 ⁰ 120 12×10 ⁰ | | —T Tape & Reel | | △ Standard products △=Blank space | | |

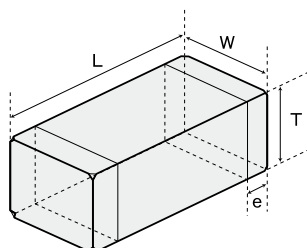EXTERNAL DIMENSIONS/STANDARD QUANTITY



| Type | L | W | T | e | Standard Quantity [pcs] |
|-------------|---------------------------|---------------------------|---------------------------|----------------------------|-------------------------|
| | | | | | Taping |
| 0603 (0201) | 0.6±0.03 (0.024±0.001) | 0.3±0.03 (0.012±0.001) | 0.3±0.03 (0.012±0.001) | 0.15±0.05 (0.006±0.002) | 15000 |

Unit : mm (inch)

PART NUMBERS

- 0603 TYPE (Operating Temperature : -40~+85°C)


| Ordering Code | EHS (Environmental Hazardous Substances) | Varistor Voltage V1mA (V) | Varistor volt- age tolerance | Rated Voltage DC (V) | Clamping Voltage V0.1A (V) | ESD Peak Voltage 150pF 330Ω contact discharge (kV) | Peak current 8/20 μsec. (A) | Capacitance (reference value) 1kHz 1Vrms (pF) |
|---------------|---|---------------------------------|---------------------------------|-------------------------|----------------------------------|---|--------------------------------|---|
| VR063 101A120 | RoHS | 12 | ±20% | 7.5 | 22 | 15 | 3 | 100 |
| VR063 330A120 | RoHS | 12 | ±20% | 7.5 | 22 | 8 | 1 | 33 |
| VR063 101A080 | RoHS | 8 | ±20% | 5.5 | 15 | 15 | 3 | 100 |
| VR063 101A6R8 | RoHS | 6.8 | ±30% | 3.5 | 15 | 8 | 3 | 100 |

* This catalog contains the typical specification only due to the limitation of space. When you consider the purchase of our products, please check our specification. For details of each product (characteristics graph, reliability information, precautions for use, and so on), see our Web site (<http://www.ty-top.com/>) or CD catalogs.

① Minimum Quantity


| Type | Thickness mm (inch) | Standard Quantity [pcs] |
|------------------|------------------------|-------------------------|
| | | Taping |
| 1005・105C (0402) | 0.5 (0.020) | 10000 |
| 0603 (0201) | 0.3 (0.012) | 15000 |

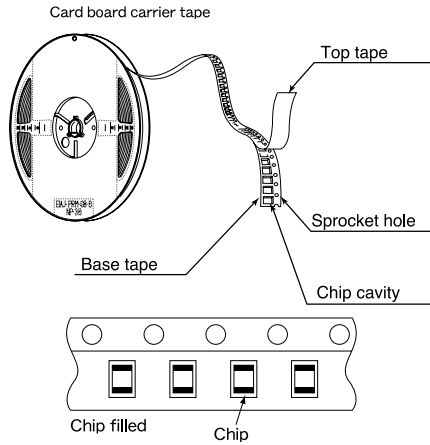② Tape material



③ Taping Dimensions

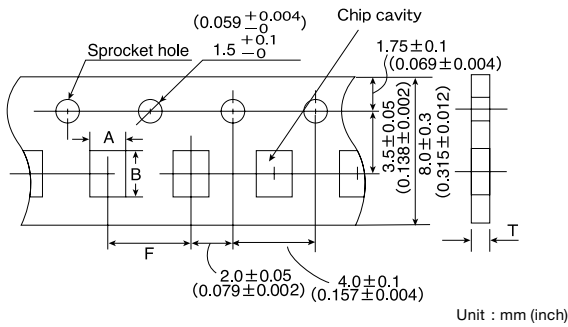
- Paper tape 8mm wide (0.315 inches wide)




| Type | Chip cavity | | Insertion pitch | Tape thickness |
|------------------|------------------------------------|------------------------------------|-----------------------------------|---------------------------|
| | A | B | F | T |
| 1005・105C (0402) | 0.65 ± 0.1 (0.026 ± 0.004) | 1.15 ± 0.1 (0.045 ± 0.004) | 2.0 ± 0.05 (0.079 ± 0.002) | 0.80 max. (0.031 max.) |
| 0603 (0201) | 0.40 ± 0.06 (0.016 ± 0.002) | 0.70 ± 0.06 (0.028 ± 0.002) | 2.0 ± 0.05 (0.079 ± 0.002) | 0.45 max. (0.018 max.) |

Unit : mm (inch)

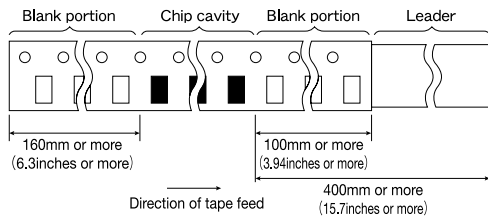④ Leader and Blank portion




⑤ Reel size

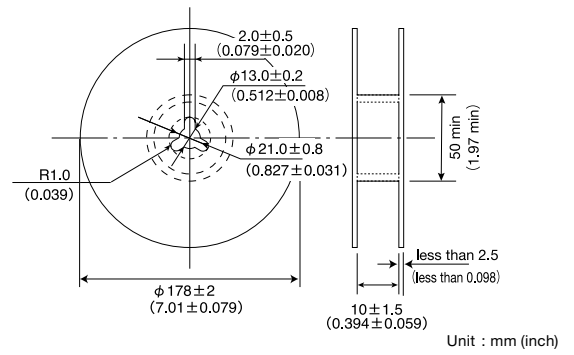


⑥ Top Tape Strength

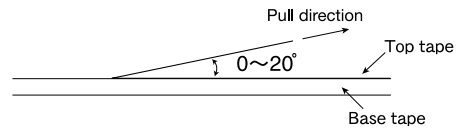The top tape requires a peel-off force of 0.1~0.7N in the direction of the arrow as illustrated below.



RELIABILITY DATA
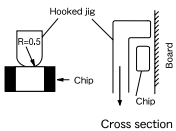
| | |
|---|--|
| 1. Operating Temperature Range | |
| Specified Value | VR1005 : -55~+125°C VR063, VR105C : -40~+85°C |
| 2. Storage Temperature Range | |
| Specified Value | -55~+125°C |
| 3. Rated voltage | |
| Specified Value | Refer to the part number section. |
| [Test Methods and Remarks] Maximum DC for continuous application within operating temperature range. | |
| 4. Varistor voltage | |
| Specified Value | Refer to the part number section. |
| [Test Methods and Remarks] Voltage between terminals at application of DC 1mA. | |
| 5. Clamp voltage | |
| Specified Value | Refer to the part number section. |
| [Test Methods and Remarks] 8/20μs, 0.1A | |
| 6. Capacitance | |
| Specified Value | Refer to the part number section. |
| [Test Methods and Remarks] Measured at specified measuring frequency, 1 Vrms, 0V bias. | |
| 7. ESD Peak voltage | |
| Specified Value | Refer to the part number section. |
| [Test Methods and Remarks] 150pF 330Ω contact discharge (IEC61000-4-2) Maximum ESD voltage that can be withstood without deteriorating varistor characteristics when an ESD voltage is applied once. | |
| 8. Withstanding surge current | |
| Specified Value | Refer to the part number section. |
| [Test Methods and Remarks] Maximum current that can be withstood without deteriorating varistor characteristics when an impulse current (8/20μs) is applied once. | |
| 9. High Temperature Loading | |
| Specified Value | VR1005, 063 : $\Delta V1mA/V1mA \leq \pm 10\%$ VR105C : $\Delta Cp/Cp \leq \pm 30\%$ |
| [Test Methods and Remarks] VR1005 : 125±3°C Rated voltage 500h±12h VR063, VR105C : 85±3°C Rated voltage 500h±12h | |
| 10. Humidity Loading | |
| Specified Value | VR1005, VR063 : $\Delta V1mA/V1mA \leq \pm 10\%$ VR105C : $\Delta Cp/Cp \leq \pm 30\%$ |
| [Test Methods and Remarks] 40±2°C, 90 to 95% RH, Rated voltage, 500h±12h | |
| 11. Thermal Shock | |
| Specified Value | No mechanical damage. VR1005, VR063 : $\Delta V1mA/V1mA \leq \pm 10\%$ VR105C : $\Delta Cp/Cp \leq \pm 30\%$ |
| [Test Methods and Remarks] Conditions for 1 cycle Step1 : Minimum operating temperature $+0_{-3}^{\circ}C$: 30±3min. Step2 : Room temperature : 2 to 3 min. Step3 : Maximum operating temperature $+0_{-3}^{\circ}C$: 30±3min. Step4 : Room temperature : 2 to 3 min. Number of cycles : 5 | |
| 12. Solderability | |
| Specified Value | More than 75% of the termination shall be covered with fresh solder. |
| [Test Methods and Remarks] 235±5°C, 2±0.5 sec. Solder : H63A Flux : Rosin ethanol solution (25wt%) | |
| 13. Resistance to Soldering Heat | |
| Specified Value | No mechanical damage such as crack. VR1005, VR063 : $\Delta V1mA/V1mA \leq \pm 10\%$ VR105C : $\Delta Cp/Cp \leq \pm 30\%$ |
| [Test Methods and Remarks] 260±5°C, 10±1 sec. Solder : H63A Flux : Rosin ethanol solution (25wt%) | |
| 14. Adhesive force of terminal electrodes | |
| Specified Value | Without electrode peeling. |
| [Test Methods and Remarks] 1005, 105C Type : After samples have been soldered to the PCB, a force of 5N (0.51kgf) in the horizontal direction shall be applied for 10±1 seconds as shown in below diagram. 063 Type : After samples have been soldered to the PCB, a force of 2N (0.20kgf) in the horizontal direction shall be applied for 10±1 seconds as shown in below diagram. | |
|  | |

* This catalog contains the typical specification only due to the limitation of space. When you consider the purchase of our products, please check our specification.
For details of each product (characteristics graph, reliability information, precautions for use, and so on), see our Web site (<http://www.ty-top.com/>) or CD catalogs.

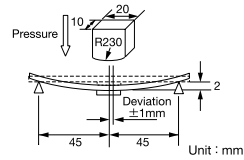
15. Bending strength

Specified Value

No mechanical damage.

【Test Methods and Remarks】

Warp : 2mm
Testing board : glass epoxy-resin substrate
Thickness : 0.8mm



Note on standard condition :

"standard condition" referred to herein is defined as follows

5 to 35°C of temperature, 45 to 85% relative humidity and 86 to 106kPa of air pressure.

When there are questions concerning measurement result :

In order to provide correlation data, the test shall be conducted under condition of $20\pm 2^\circ\text{C}$ of temperature, 60 to 70% relative humidity and 86 to 106kPa of air pressure.

Unless otherwise specified, all the tests are conducted under the "standard condition."

PRECAUTIONS

Precautions on the use of Multilayer chip varistors.


1. Circuit Design

| | |
|-------------|---|
| Precautions | <p>◆ Verification of operating environment, electrical rating and performance</p> <p>1. A malfunction in medical equipment, spacecraft, nuclear reactors, etc. may cause serious harm to human life or have severe social ramifications. As such, any varistors to be used in such equipment may require higher safety and/or reliability considerations and should be clearly differentiated from components used in general purpose applications.</p> |
| | <p>◆ Operating Voltage (Verification of Rated voltage)</p> <p>1. The operating voltage for varistors must always be lower than their rated values.</p> <p>If an AC voltage is loaded on a DC voltage, the sum of the two peak voltages should be lower than the rated value of the varistor chosen. For a circuit where both an AC and a pulse voltage may be present, the sum of their peak voltages should also be lower than the varistor's rated voltage.</p> |

2. PCB Design

| | |
|-------------|--|
| Precautions | <p>◆ Pattern configurations (Design of Land-patterns)</p> <p>1. When varistors are mounted on a PCB, the amount of solder used (size of fillet) can directly affect varistor performance. Therefore, the following items must be carefully considered in the design of solder land patterns :</p> <p>(1) The amount of solder applied can affect the ability of chips to withstand mechanical stresses which may lead to breaking or cracking. Therefore, when designing land-patterns it is necessary to consider the appropriate size and configuration of the solder pads which in turn determines the amount of solder necessary to form the fillets.</p> <p>(2) When more than one part is jointly soldered onto the same land or pad, the pad must be designed so that each component's soldering point is separated by solder-resist.</p> |
| | <p>◆ Pattern configurations (varistor layout on panelized [breakaway] PC boards)</p> <p>1. After varistors have been mounted on the boards, chips can be subjected to mechanical stresses in subsequent manufacturing processes (PCB cutting, board inspection, mounting of additional parts, assembly into the chassis, wave soldering the reflow soldered boards etc). For this reason, planning pattern configurations and the position of SMD varistors should be carefully performed to minimize stress.</p> |

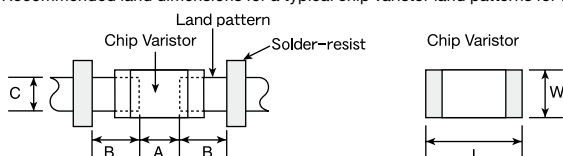- ◆ Pattern configurations (Design of Land-patterns)
1. The following diagrams and tables show some examples of recommended patterns to prevent excessive solder amounts. (larger fillets which extend above the component end terminations) Examples of improper pattern designs are also shown.
- (1) Recommended land dimensions for a typical chip varistor land patterns for PCBs



Recommended land dimensions for reflow-soldering

| Type | 063 | 1005, 105C |
|------|-----------|------------|
| Size | L | 0.6 |
| | W | 0.3 |
| A | 0.2~0.30 | 0.45~0.55 |
| B | 0.2~0.30 | 0.40~0.50 |
| C | 0.25~0.40 | 0.45~0.55 |

Unit : mm

Excess solder can affect the ability of chips to withstand mechanical stresses. Therefore, please take proper precautions when designing land-patterns.

(2) Examples of good and bad solder application

| Items | Not recommended | Recommended |
|---|-----------------|-------------|
| Mixed mounting of SMD and leaded components | | |
| Component placement close to the chassis | | |
| Hand-soldering of leaded components near mounted components | | |
| Horizontal component placement | | |


Technical considerations

◆ Pattern configurations (varistor layout on panelized [breakaway] PC boards)

1-1. The following are examples of good and bad varistor layout; SMD varistors should be located to minimize any possible mechanical stresses from board warp or deflection.

| | Not recommended | Recommended |
|-------------------------|-----------------|---|
| Deflection of the board | | Position the component at a right angle to the direction of the mechanical stresses that are anticipated. |

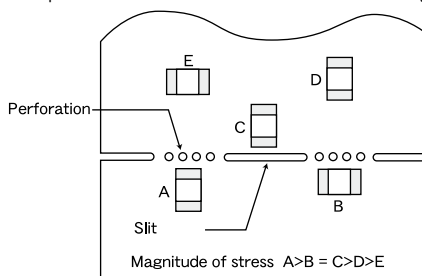1-2. To layout the varistors for the breakaway PC board, it should be noted that the amount of mechanical stresses given will vary depending on varistor layout. The example below shows recommendations for better design.















1-3. When breaking PC boards along their perforations, the amount of mechanical stress on the varistors can vary according to the method used. The following methods are listed in order from least stressful to most stressful: push-back, slit, V-grooving, and perforation. Thus, any ideal SMD varistor layout must also consider the PCB splitting procedure.

* This catalog contains the typical specification only due to the limitation of space. When you consider the purchase of our products, please check our specification. For details of each product (characteristics graph, reliability information, precautions for use, and so on), see our Web site (<http://www.ty-top.com/>) or CD catalogs.




PRECAUTIONS

Precautions on the use of Multilayer chip varistors.

3. Considerations for automatic placement

| | | | | | | | | | | |
|--------------------------|---|---|-----------------|-------------|-----------------------|---|---|-----------------------|---|---|
| Precautions | <ul style="list-style-type: none">◆Adjustment of mounting machine<ul style="list-style-type: none">1. Excessive impact load should not be imposed on the varistors when mounting onto the PC boards.2. The maintenance and inspection of the mounters should be conducted periodically.◆Selection of Adhesives<ul style="list-style-type: none">1. Mounting varistors with adhesives in preliminary assembly, before the soldering stage, may lead to degraded varistor characteristics unless the following factors are appropriately checked; the size of land patterns, type of adhesive, amount applied, hardening temperature and hardening period. Therefore, it is imperative to consult the manufacturer of the adhesives on proper usage and amounts of adhesive to use. | | | | | | | | | |
| Technical considerations | <ul style="list-style-type: none">◆Adjustment of mounting machine<ul style="list-style-type: none">1. If the lower limit of the pick-up nozzle is low, too much force may be imposed on the capacitors, causing damage. To avoid this, the following points should be considered before lowering the pick-up nozzle :<ul style="list-style-type: none">(1) The lower limit of the pick-up nozzle should be adjusted to the surface level of the PC board after correcting for deflection of the board.(2) The pick-up pressure should be adjusted between 1 and 3N static loads.(3) To reduce the amount of deflection of the board caused by impact of the pick-up nozzle, supporting pins or back-up pins should be used under the PC board. The following diagrams show some typical examples of good pick-up nozzle placement :<table><tr><td></td><td>Not recommended</td><td>Recommended</td></tr><tr><td>Single-sided mounting</td><td></td><td></td></tr><tr><td>Double-sided mounting</td><td></td><td></td></tr></table><ul style="list-style-type: none">2. As the alignment pin wears out, adjustment of the nozzle height can cause chipping or cracking of the varistors because of mechanical impact on the varistors. To avoid this, the monitoring of the width between the alignment pin in the stopped position, and maintenance, inspection and replacement of the pin should be conducted periodically.◆Selection of Adhesives<ul style="list-style-type: none">1. Some adhesives may cause reduced insulation resistance. The difference between the shrinkage percentage of the adhesive and that of the varistors may result in stresses on the varistors and lead to cracking. Moreover, too little or too much adhesive applied to the board may adversely affect component placement, so the following precautions should be noted in the application of adhesives.<ul style="list-style-type: none">(1) Required adhesive characteristics<ul style="list-style-type: none">a. The adhesive should be strong enough to hold parts on the board during the mounting & solder process.b. The adhesive should have sufficient strength at high temperatures.c. The adhesive should have good coating and thickness consistency.d. The adhesive should be used during its prescribed shelf life.e. The adhesive should harden rapidly.f. The adhesive must not be contaminated.g. The adhesive should have excellent insulation characteristics.h. The adhesive should not be toxic and have no emission of toxic gasses.(2) When the amount of adhesive is inappropriate to mount varistors on a PCB, that may cause a problem in placement of the component. Too little adhesive may cause the varistors to fall off the board during the solder process. Too much adhesive may cause defective soldering due to excessive flow of adhesive on to the land or solder pad. | | Not recommended | Recommended | Single-sided mounting |  |  | Double-sided mounting |  |  |
| | Not recommended | Recommended | | | | | | | | |
| Single-sided mounting |  |  | | | | | | | | |
| Double-sided mounting |  |  | | | | | | | | |

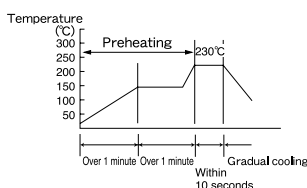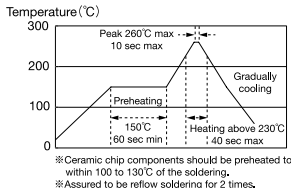4. Soldering

| | |
|--------------------------|---|
| Precautions | <p>◆Selection of Flux</p> <ol style="list-style-type: none"> Since flux may have a significant effect on the performance of varistors, it is necessary to verify the following conditions prior to use : <ol style="list-style-type: none"> Flux used should be with less than or equal to 0.1 wt% (equivalent to chlorine) of halogenated content. Flux having a strong acidity content should not be applied. When soldering varistors on the board, the amount of flux applied should be controlled at the optimum level. When using water-soluble flux, special care should be taken to properly clean the boards. <p>◆Soldering</p> <ol style="list-style-type: none"> Temperature, time, amount of solder, etc. are specified in accordance with the following recommended conditions. |
| Technical considerations | <p>◆Selection of Flux</p> <ol style="list-style-type: none"> When too much halogenated substance (Chlorine, etc.) content is used to activate the flux, or highly acidic flux is used, an excessive amount of residue after soldering may lead to corrosion of the terminal electrodes or degradation of insulation resistance on the surface of the varistors. Since the residue of water-soluble flux is easily dissolved by water content in the air, the residue on the surface of varistors in high humidity conditions may cause a degradation of insulation resistance and therefore affect the reliability of the components. The cleaning methods and the capability of the machines used should also be considered carefully when selecting water-soluble flux. <p>◆Soldering</p> <ol style="list-style-type: none"> Preheating when soldering <p>Heating : Ceramic chip components should be preheated to within 100 to 130°C of the soldering.</p> <p>Cooling : The temperature difference between the components and cleaning process should not be greater than 100°C.</p> <p>Ceramic chip varistors are susceptible to thermal shock when exposed to rapid or concentrated heating or rapid cooling. Therefore, the soldering process must be conducted with great care so as to prevent malfunction of the components due to excessive thermal shock.</p> <p>Recommended conditions for soldering</p> <p>[Reflow soldering]</p> <p>Temperature profile</p> <div style="display: flex; justify-content: space-around;"> <div data-bbox="288 1589 596 1777">  </div> <div data-bbox="715 1589 1007 1777">  </div> </div> <p>Caution</p> <ol style="list-style-type: none"> The ideal condition is to have solder mass (fillet) controlled to 1/2 to 1/3 of the thickness of the varistor, as shown below : <div style="text-align: center;">  </div> <ol style="list-style-type: none"> Because excessive dwell times can detrimentally affect solder ability, soldering duration should be kept as close to recommended times as possible. |

* This catalog contains the typical specification only due to the limitation of space. When you consider the purchase of our products, please check our specification. For details of each product (characteristics graph, reliability information, precautions for use, and so on), see our Web site (<http://www.ty-top.com/>) or CD catalogs.

■ PRECAUTIONS

Precautions on the use of Multilayer chip varistors.

| | |
|----------------------------|--|
| 5. Cleaning | |
| Precautions | <p>◆Cleaning conditions</p> <ol style="list-style-type: none"> 1. When cleaning the PC board after the varistors are all mounted, select the appropriate cleaning solution according to the type of flux used and purpose of the cleaning (e.g. to remove soldering flux or other materials from the production process.) 2. Cleaning conditions should be determined after verifying, through a test run, that the cleaning process does not affect the varistor's characteristics. |
| Technical considerations | <p>◆Cleaning conditions</p> <ol style="list-style-type: none"> 1. The use of inappropriate solutions can cause foreign substances such as flux residue to adhere to the varistor or deteriorate the varistor's outer coating, resulting in a degradation of the varistor's electrical properties (especially insulation resistance). 2. Inappropriate cleaning conditions (insufficient or excessive cleaning) may detrimentally affect the performance of the varistors. <ol style="list-style-type: none"> (1) Excessive cleaning In the case of ultrasonic cleaning, too much power output can cause excessive vibration of the PC board which may lead to the cracking of the varistor or the soldered portion, or decrease the terminal electrodes' strength. Thus the following conditions should be carefully checked; Ultrasonic output : Below 20W/l Ultrasonic frequency : Below 40kHz Ultrasonic washing period : 5 min. or less |
| 6. Post cleaning processes | |
| Precautions | <p>◆Application of resin coating, molding, etc. to the PCB and components</p> <ol style="list-style-type: none"> 1. With some type of resins a decomposition gas or chemical reaction vapor may remain inside the resin during the hardening period or while left under normal storage conditions resulting in the deterioration of the varistor's performance. 2. When a resin's hardening temperature is higher than the varistor's operating temperature, the stresses generated by the excess heat may lead to varistor damage or destruction. The use of such resins, molding materials etc. is not recommended. |
| 7. Handling | |
| Precautions | <p>◆Breakaway PC boards (splitting along perforations)</p> <ol style="list-style-type: none"> 1. When splitting the PC board after mounting varistors and other components, care is required so as not to give any stresses of deflection or twisting to the board. 2. Board separation should not be done manually, but by using the appropriate devices. <p>◆Mechanical considerations</p> <ol style="list-style-type: none"> 1. Be careful not to apply excessive mechanical shocks to the varistors. <ol style="list-style-type: none"> (1) If ceramic varistors are dropped onto the floor or a hard surface, they should not be used. (2) When handling the mounted boards, be careful that the mounted components do not come in contact with or bump against other boards or components. |
| 8. Storage conditions | |
| Precautions | <p>◆Storage</p> <ol style="list-style-type: none"> 1. To maintain the solder ability of terminal electrodes and to keep the packaging material in good condition, care must be taken to control temperature and humidity in the storage area. Humidity should especially be kept as low as possible. <ul style="list-style-type: none"> • Recommended conditions Ambient temperature: Below 40°C Humidity : Below 70% RH <p>The ambient temperature must be kept below 30°C. Even under ideal storage conditions varistor electrode solderability decreases as time passes, so should be used within 6 months from the time of delivery.</p> • Ceramic chip varistors should be kept where no chlorine or sulfur exists in the air. |
| Technical considerations | <p>◆Storage</p> <ol style="list-style-type: none"> 1. If the parts are stored in a high temperature and humidity environment, problems such as reduced solderability caused by oxidation of terminal electrodes and deterioration of taping/package materials may take place. For this reason, components should be used within 6 months from the time of delivery. If exceeding the above period, please check the solderability before using the varistors. |

* This catalog contains the typical specification only due to the limitation of space. When you consider the purchase of our products, please check our specification. For details of each product (characteristics graph, reliability information, precautions for use, and so on), see our Web site (<http://www.ty-top.com/>) or CD catalogs.