PRODUCT TYPES * TOUGH CONTRET

Mated height	Number of pins	Part n	umber	Packing		
	Number of pins	Socket	Header	Inner carton	Outer carton	
	10	AXT510124	AXT610124			
	12	AXT512124	AXT612124			
	14	AXT514124	AXT614124			
	16	AXT516124	AXT616124			
	20	AXT520124	AXT620124			
	22	AXT522124	AXT622124			
	24	AXT524124	AXT624124			
	26	AXT526124	AXT626124			
	28	AXT528124	AXT628124			
	30	AXT530124	AXT630124			
	32	AXT532124	AXT632124			
1.0mm	34	AXT534124	AXT634124			
	36	AXT536124	AXT636124			
	40	AXT540124	AXT640124			
	42	AXT542124	AXT642124	3,000 pieces	6,000 pieces	
	44	AXT544124	AXT644124			
	48	AXT548124	AXT648124			
	50	AXT550124	AXT650124			
	54	AXT554124	AXT654124			
	60	AXT560124	AXT660124			
	64	AXT564124	AXT664124			
	70	AXT570124	AXT670124			
	80	AXT580124	AXT680124			
	10	AXT510224	AXT610224			
	30	AXT530224	AXT630224			
1.2mm	40	AXT540224	AXT640224			
1.411111	50	AXT550224	AXT650224			
	70	AXT570224	AXT670224			
	80	AXT580224	AXT680224			

Notes: 1. Order unit: For volume production: 1-inner-box (1-reel) units Samples for mounting check: 50-connector units. Please contact our sales office. Samples: Small lot orders are possible. Please contact our sales office.

SPECIFICATIONS

1. Characteristics

	Item	Specifications	Conditions						
	Rated current	0.3A/pin contact (Max. 5 A at total pin contacts)							
	Rated voltage	60V AC/DC							
Electrical characteristics	Breakdown voltage	150V AC for 1 min.	No short-circuiting or damage at a detection current of 1 mA when the specified voltage is applied for one minute.						
Characteristics	Insulation resistance	Min. 1,000M Ω (initial)	Using 250V DC megger (applied for 1 min.)						
	Contact resistance	Max. 90mΩ	Based on the contact resistance measurement method specified by JIS C 5402.						
	Composite insertion force	Max. 0.981N/pin contacts × pin contacts (initial)							
Mechanical	Composite removal force	Min. 0.165N/pin contacts × pin contacts							
characteristics	Contact holding force (Socket contact)	Min. 0.49N/pin contacts	Measuring the maximum force. As the contact is axially pull out.						
	Ambient temperature	-55°C to +85°C	No freezing at low temperatures. No dew condensation.						
	Soldering heat resistance	Peak temperature: 260°C or less (on the surface of the PC board around the connector terminals)	Infrared reflow soldering						
	_	300°C within 5 sec. 350°C within 3 sec.	Soldering iron						
	Storage temperature	-55°C to +85°C (product only) -40°C to +50°C (emboss packing)	No freezing at low temperatures. No dew condensation.						
			Conformed to MIL-STD-202F, method 107G						
	Thermal shock resistance (header and socket mated)		Order Temperature (°C) Time (minutes)						
		5 cycles,	1 -55_\(\) 30						
Environmental		insulation resistance min. $100M\Omega$, contact resistance max. $90m\Omega$	2 S Max. 5						
characteristics		Contact resistance max. 90ms2	3 85 ⁺³ 30						
			4 \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \						
	Humidity resistance (header and socket mated)	120 hours, insulation resistance min. 100M Ω , contact resistance max. $90m\Omega$	Bath temperature 40±2°C, humidity 90 to 95% R.H.						
	Saltwater spray resistance (header and socket mated)	24 hours, insulation resistance min. 100M Ω , contact resistance max. 90m Ω	Bath temperature 35±2°C, saltwater concentration 5±1%						
	H₂S resistance (header and socket mated)	48 hours, contact resistance max. 90mΩ	Bath temperature 40±2°C, gas concentration 3±1 ppm, humidity 75 to 80% R.H.						
Lifetime characteristics	Insertion and removal life	50 times	Repeated insertion and removal speed of max. 200 times/hours						
Unit weight		20 pin contact type: Socket: 0.03 g Header: 0.01 g							

2. Material and surface treatment


	···································									
Part name	Material	Surface treatment								
Molded portion	LCP resin (UL94V-0)	_								
Contact and Post	Copper alloy	Contact portion: Base: Ni plating Surface: Au plating Terminal portion: Base: Ni plating Surface: Au plating (except the terminal tips) The socket terminals close to the portion to be soldered have nickel barriers (exposed nickel portions). Soldering terminals: Sockets: Base: Ni plating Surface: Pd+Au flash plating (except the terminal tips) Headers: Base: Ni plating Surface: Au plating (except the terminal tips)								

DIMENSIONS (Unit: mm)


The CAD data of the products with a CAD Data mark can be downloaded from: http://industrial.panasonic.com/ac/e/

Socket (Mated height: 1.0 mm and 1.2 mm)



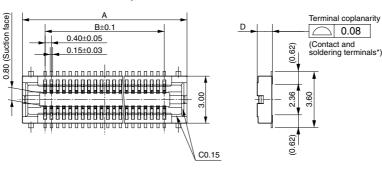



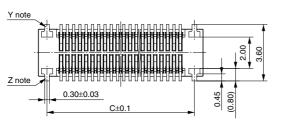


Note: Since the soldering terminals* has a single-piece construction, sections Y and Z are electrically connected.


Dimension table (mm)

Simension table (min)						
Number of pins/ dimension	А		С			
10	4.50	1.60	3.40			
12	4.90	2.00	3.80			
14	5.30	2.40	4.20			
16	5.70	2.80	4.60			
20	6.50	3.60	5.40			
22	6.90	4.00	5.80			
24	7.30	4.40	6.20			
26	7.70	4.80	6.60			
28	8.10	5.20	7.00			
30	8.50	5.60	7.40			
32	8.90	6.00	7.80			
34	9.30	6.40	8.20			
36	9.70	6.80	8.60			
40	10.50	7.60	9.40			
42	10.90	8.00	9.80			
44	11.30	8.40	10.20			
48	12.10	9.20	11.00			
50	12.50	9.60	11.40			
54	13.30	10.40	12.20			
60	14.50	11.60	13.40			
64	15.30	12.40	14.20			
70	16.50	13.60	15.40			
80	18.50	15.60	17.40			

Header (Mated height: 1.0 mm and 1.2 mm)



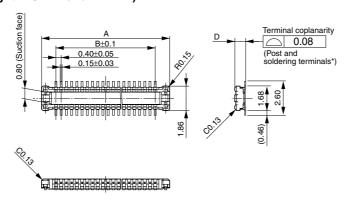

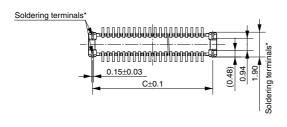

General tolerance: ±0.2

General tolerance: ±0.2

0.97

1.0mm

1.2mm

Mated height/ dimension	D
1.0mm	0.83
1.2mm	1.01

Dimension table (mm)

А		С
3.80	1.60	3.20
4.20	2.00	3.60
4.60	2.40	4.00
5.00	2.80	4.40
5.80	3.60	5.20
6.20	4.00	5.60
6.60	4.40	6.00
7.00	4.80	6.40
7.40	5.20	6.80
7.80	5.60	7.20
8.20	6.00	7.60
8.60	6.40	8.00
9.00	6.80	8.40
9.80	7.60	9.20
10.20	8.00	9.60
10.60	8.40	10.00
11.40	9.20	10.80
11.80	9.60	11.20
12.60	10.40	12.00
13.80	11.60	13.20
14.60	12.40	14.00
15.80	13.60	15.20
17.80	15.60	17.20
	3.80 4.20 4.60 5.00 5.80 6.20 6.60 7.40 7.80 8.20 8.60 9.00 9.80 10.20 11.40 11.80 12.60 13.80 14.60 15.80	3.80 1.60 4.20 2.00 4.60 2.40 5.00 2.80 5.80 3.60 6.20 4.00 6.60 4.40 7.00 4.80 7.40 5.20 7.80 5.60 8.20 6.00 8.60 6.40 9.00 6.80 9.80 7.60 10.20 8.00 10.60 8.40 11.40 9.20 11.80 9.60 12.60 10.40 13.80 11.60 14.60 12.40 15.80 13.60

Socket and Header are mated




Mated height: 1.0 mm


Mated height: 1.2 mm


EMBOSSED TAPE DIMENSIONS (Unit: mm) (Common to all sockets and headers)


· Specifications for taping

(In accordance with JIS C 0806:1990. However, not applied to the mounting-hole pitch of some connectors.)



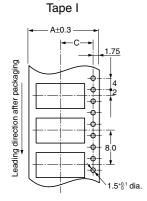

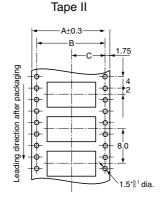


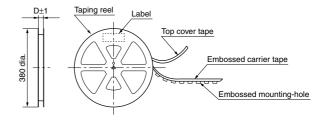

• Dimension table (Unit: mm)

Type/Mated height	Number of pins	Type of taping	A	В	С	D	Quantity per reel
Common for	24 or less	Tape I	16.00	_	7.50	17.40	3,000
sockets and headers:	26 to 70	Tape I	24.00	_	11.50	25.40	3,000
1.0mm, 1.2mm	80	Tape II	32.00	28.40	14.20	33.40	3,000


• Connector orientation with respect to embossed tape feeding direction

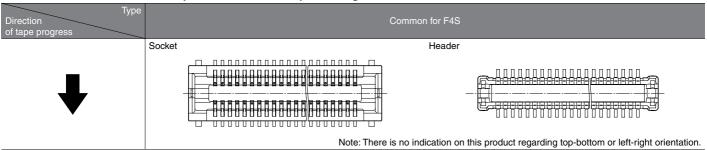

For board-to-FPC

Connectors for inspection usage (0.4mm pitch)

F4S Series



RoHS compliant

FEATURES

- 1. 3,000 mating and unmating cycles
- 2. Same external dimensions and foot pattern as standard type.
- 3. Improved mating

Insertion and removal easy due to a reduction in mating retention force. This is made possible by a simple locking structure design.

Note: Mating retention force cannot be warranted.

APPLICATIONS

Ideal for module unit inspection and equipment assembly inspection

TABLE OF PRODUCT TYPES

☆: Available for sale

Product name		Number of pins																						
F4S	10	12	2	14	16	20	22	24	26	28	30	32	34	36	40	42	44	48	50	54	60	64	70	80
for inspection	☆	☆	,	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆

Notes: 1. Please inquire about number of pins other than those shown above.

- 2. Please inquire with us regarding availability.
- 3. Please keep the minimum order quantities no less than 50 pieces per lot.
- 4. Please inquire if further information is needed.
- 5. Please note that this inspection connector cannot be connected to standard models with a stacking height of 1.2 mm (AXT5**224 and AXT6**224). Please contact our sales office for a type connectable to models with a stacking height of 1.2 mm.

PRODUCT TYPES

	Specifications	Part No.		Part No.		
Socket	Without positioning bosses	AXT5E**26	Header	Without positioning bosses	AXT6E**26	

Notes: 1. When placing an order, substitute the "*" (asterisk) in the above part number with the number of pins for the specific connector.

2. The above part numbers are for connectors without positioning bosses, which are standard. When ordering connectors with positioning bosses, please contact our local sales office.

NOTES


- 1. For high resistance to drop impact the F4 series is recommended.
- 2. Recommended PC board and metal mask patterns

Connectors are mounted with high pitch density, intervals of 0.35 mm, 0.4 mm or 0.5 mm.


In order to reduce solder and flux rise, solder bridges and other issues make sure the proper levels of solder is used. The figures to the right are recommended metal mask patterns. Please use them as a reference.

• Socket (Mated height: 1.0 mm)


Recommended PC board pattern (TOP VIEW)

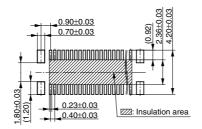

Recommended metal mask pattern Metal mask thickness: When 150µm (Terminal opening ratio: 48%) (Metal-part opening ratio: 100%)

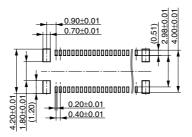


Recommended metal mask pattern Metal mask thickness: When 120µm (Terminal opening ratio: 60%) (Metal-part opening ratio: 100%)

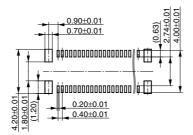


• Header (Mated height: 1.0 mm)


Recommended PC board pattern (TOP VIEW)

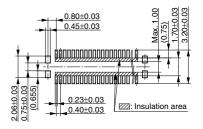

Recommended metal mask pattern Metal mask thickness: When 150μm (Terminal opening ratio: 48%) (Metal-part opening ratio: 100%)

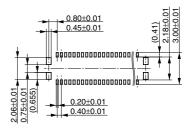

Recommended metal mask pattern Metal mask thickness: When 120µm (Terminal opening ratio: 60%) (Metal-part opening ratio: 100%)

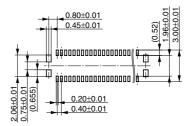

Please note that this inspection connector cannot be connected to standard models with a stacking height of 1.2 mm (AXT5**224 and AXT6**224).

Please contact our sales office for a type connectable to models with a stacking height of 1.2 mm.

Please refer to the latest product specifications when designing your product.


Notes on Using Narrow pitch Connectors

Regarding the design of devices and PC board patterns

- 1) When connecting several connectors together by stacking, make sure to maintain proper accuracy in the design of structure and mounting equipment so that the connectors are not subjected to twisting and torsional forces.
- 2) With mounting equipment, there may be up to a ± 0.2 to 0.3-mm error in positioning. Be sure to design PC boards and patterns while taking into consideration the performance and abilities of the required equipment.
- 3) Some connectors have tabs embossed on the body to aid in positioning. When using these connectors, make sure that the PC board is designed with positioning holes to match these tabs.
- 4) To ensure the required mechanical strength when soldering the connector terminals, make sure the PC board meets recommended PC board pattern design dimensions given.

5) For all connectors of the narrow pitch series, to prevent the PC board from coming off during vibrations or impacts, and to prevent loads from falling directly on the soldered portions, be sure to design some means to fix the PC board in place.

Example) Secure in place with screws

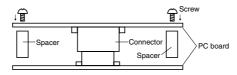

When connecting PC boards, take appropriate measures to prevent the connector from coming off.

- 6) Notes when using a FPC.
- (1) When the connector is soldered to an FPC board, during its insertion and removal procedures, forces may be applied to the terminals and cause the soldering to come off. It is recommended to use a reinforcement board on the

backside of the FPC board to which the connector is being connected. Please make the reinforcement board dimensions bigger than the outer limits of the recommended PC board pattern (should be approximately 1 mm greater than the outer limit).

Material should be glass epoxy or polyimide, and the thickness should be between 0.2 and 0.3 mm.

- (2) Collisions, impacts, or turning of FPC boards, may apply forces on the connector and cause it to come loose. Therefore, make to design retaining plates or screws that will fix the connector in place.
- 7) The narrow pitch connector series is designed to be compact and thin. Although ease of handling has been taken into account, take care when mating the connectors, as displacement or angled mating could damage or deform the connector.

Regarding the selection of the connector placement machine and the mounting procedures


- 1) Select the placement machine taking into consideration the connector height, required positioning accuracy, and packaging conditions.
- 2) Be aware that if the catching force of the placement machine is too great, it may deform the shape of the connector body or connector terminals.
- 3) Be aware that during mounting, external forces may be applied to the connector contact surfaces and terminals and cause deformations.
- 4) Depending on the size of the connector being used, self alignment may not be possible. In such cases, be sure to carefully position the terminal with the PC board pattern.
- 5) The positioning bosses give an approximate alignment for positioning on the PC board. For accurate positioning of the connector when mounting it to the PC board, we recommend using an automatic positioning machine.
- 6) Excessive mounter chucking force may deform the molded or metal part of the connector. Consult us in advance if chucking is to be applied.

Notes on Using Narrow pitch Connectors

Regarding soldering

1. Reflow soldering

- 1) Measure the recommended profile temperature for reflow soldering by placing a sensor on the PC board near the connector surface or terminals. (The setting for the sensor will differ depending on the sensor used, so be sure to carefully read the instructions that comes with it.)
- 2) As for cream solder printing, screen printing is recommended.
- 3) To determine the relationship between the screen opening area and the PC-board foot pattern area, refer to the diagrams in the recommended patterns for PC boards and metal masks. Make sure to use the terminal tip as a reference position when setting. Avoid an excessive amount of solder from being applied, otherwise, interference by the solder will cause an imperfect contact.

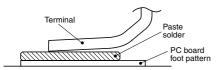


- 4) Consult us when using a screenprinting thickness other than that recommended.
- 5) When mounting on both sides of the PC board and the connector is mounting on the underside, use adhesives or other means to ensure the connector is properly fixed to the PC board. (Double reflow soldering on the same side is possible.)
- 6) N₂ reflow, conducting reflow soldering in a nitrogen atmosphere, increases the solder flow too greatly, enabling wicking to occur. Make sure that the solder feed rate and temperature profile are appropriate.


Soldering conditions

Please use the reflow temperature profile conditions recommended below for reflow soldering. Please contact us before using a temperature profile other than that described below (e.g. lead-free solder).

 Narrow pitch connectors (except P8 type)

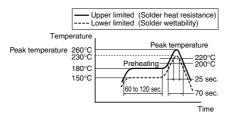

Narrow pitch connector (P8)

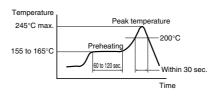

For products other than the ones above, please refer to the latest product specifications.

- 7) The temperatures are measured at the surface of the PC board near the connector terminals. (The setting for the sensor will differ depending on the sensor used, so be sure to carefully read the instructions that comes with it.)
- 8) The temperature profiles given in this catalog are values measured when using the connector on a resin-based PC board. When performed reflow soldering on a metal board (iron, aluminum, etc.) or a metal table to mount on a FPC, make sure there is no deformation or discoloration of the connector beforehand and then begin mounting.
- 9) Consult us when using a screenprinting thickness other than that recommended.
- 10) Some solder and flux types may cause serious solder or flux creeping. Solder and flux characteristics should be taken into consideration when setting the reflow soldering conditions.


2. Hand soldering

1) Set the soldering iron so that the tip temperature is less than that given in the table below.

Table A

Product name	Soldering iron temperature
SMD type connectors	300°C within 5 sec. 350°C within 3 sec.

- 2) Do not allow flux to spread onto the connector leads or PC board. This may lead to flux rising up to the connector inside.
- 3) Touch the soldering iron to the foot pattern. After the foot pattern and connector terminal are heated, apply the solder wire so it melts at the end of the connector terminals.

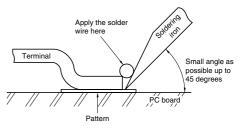

- 4) Be aware that soldering while applying a load on the connector terminals may cause improper operation of the connector.
- 5) Thoroughly clean the soldering iron.
 6) Flux from the solder wire may get on the contact surfaces during soldering operations. After soldering, carefully check the contact surfaces and clean off any solder before use.
- 7) For soldering of prototype devices during product development, you can perform soldering at the necessary locations by heating with a hot-air gun by applying cream solder to the foot pattern beforehand. However, at this time, make sure that the air pressure does not move connectors by carefully holding them down with tweezers or other similar tool. Also, be careful not to go too close to the connectors and melt any of the molded components.
- 8) If an excessive amount of solder is applied during manual soldering, the solder may creep up near the contact points, or solder interference may cause imperfect contact.

3. Solder reworking

- 1) Finish reworking in one operation.
- 2) For reworking of the solder bridge, use a soldering iron with a flat tip. To prevent flux from climbing up to the contact surfaces, do not add more flux.
- 3) Keep the soldering iron tip temperature below the temperature given in Table A.

Handling Single Components

- 1) Make sure not to drop or allow parts to fall from work bench
- 2) Excessive force applied to the terminals could cause warping, come out, or weaken the adhesive strength of the solder. Handle with care.
- 3) Repeated bending of the terminals may cause terminals to break.
- 4) Do not insert or remove the connector when it is not soldered. Forcibly applied external pressure on the terminals can weaken the adherence of the terminals to the molded part or cause the terminals to lose their evenness.
- 5) Excessive prying-force applied to one end may cause product breakage and separation of the solder joints at the terminal.

Excessive force applied for insertion in a pivot action as shown may also cause product breakage.

Align the header and socket positions before connecting them.




Cleaning flux from PC board

- 1) To increase the cleanliness of the cleaning fluid and cleaning operations, prepare equipment for cleaning process beginning with boil cleaning, ultrasonic cleaning, and then vapor cleaning.
- 2) Carefully oversee the cleanliness of the cleaning fluids to make sure that the contact surfaces do not become dirty from the cleaning fluid itself.
- 3) Since some powerful cleaning solutions may dissolve molded components of the connector and wipe off or discolor printed letters, we recommend aqua pura electronic parts cleaners. Please consult us if you wish to use other types of cleaning fluids.
- 4) Please note that the surfaces of molded parts may whiten when cleaned with alcohol.

Handling the PC board

• Handling the PC board after mounting the connector

When cutting or bending the PC board after mounting the connector, be careful that the soldered sections are subjected to excessive force.

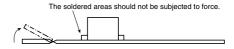

Storage of connectors

- 1) To prevent problems from voids or air pockets due to heat of reflow soldering, avoid storing the connectors in areas of high humidity. When storing the connectors for more than six months, be sure to consider storage area where the humidity is properly controlled.
- 2) Depending on the connector type, the color of the connector may vary from connector to connector depending on when it is produced.

Some connectors may change color slightly if subjected to ultraviolet rays during storage. This is normal and will not affect the operation of the connector.

3) When storing the connectors with the PC boards assembled and components alreeady set, be careful not to stack them up so the connectors are subjected to excessive forces.

4) Avoid storing the connectors in locations with excessive dust. The dust may accumulate and cause improper connections at the contact surfaces.

Other Notes


- 1) These products are made for the design of compact and lightweight devices and therefore the thickness of the molded components has been made very thin. Therefore, be careful during insertion and removal operations for excessive forces applied may damage the products.
- 2) Dropping of the products or rough mishandling may bend or damage the terminals and possibly hinder proper reflow soldering.
- 3) Before soldering, try not to insert or remove the connector more than absolutely necessary.
- 4) When coating the PC board after soldering the connector to prevent the deterioration of insulation, perform the coating in such a way so that the coating does not get on the connector.
- 5) There may be variations in the colors of products from different production lots. This is normal.
- 6) The connectors are not meant to be used for switching.
- 7) Be sure not to allow external pressure to act on connectors when assembling PCBs or moving in block assemblies.


Notes on Using Narrow pitch Connectors

Regarding sample orders to confirm proper mounting

When ordering samples to confirm proper mounting with the placement machine, connectors are delivered in 50-piece units in the condition given right. Consult a sale representative for ordering sample units.

Condition when delivered from manufacturing

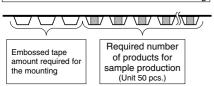

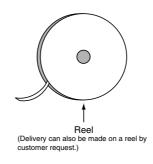

Please refer to the latest product specifications when designing your product.