
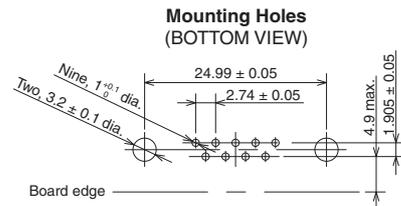




■Dimensions

(Unit: mm)

Socket XM3B-0942-1□2LS

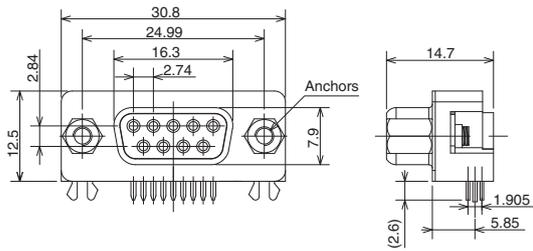

Plug XM3C-0942-1□2LS

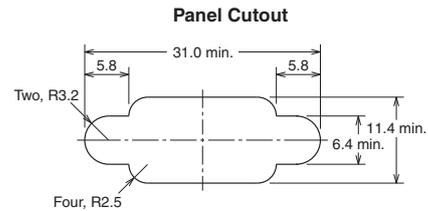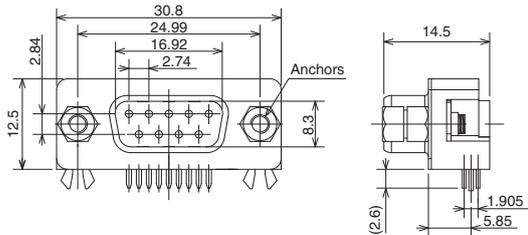

Note: The mounting hole and panel cutout dimensions are the same for the Sockets and Plugs.

■Precautions

Precautions for Correct Use

- Insert the connector into the board and then simultaneously dip-solder the connector terminals and lock pins to the board.
- Pull or push the connector straight in or out when you connect or disconnect it. Twisting it may cause damage or faulty contact.
- Do not remove the anchors from the connector. Removing the anchors may cause damage or faulty contact.
- The Plugs cannot be secured to a panel.


●Automatic Soldering

Automated Soldering Conditions (Jet Flow)

- (1) Soldering temperature: $250 \pm 5^\circ\text{C}$
- (2) Continuous soldering time: within 5 ± 1 s max.

●Mating

Do not connect the Connectors in the wrong direction, otherwise it may be damaged.

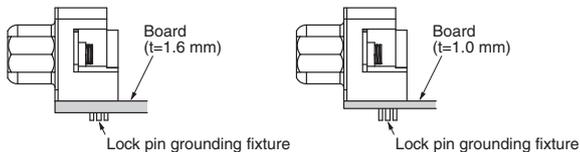

Please check each region's Terms & Conditions by region website.

OMRON Corporation

Electronic and Mechanical Components Company

Regional Contact

Americas

<https://www.components.omron.com/>

Asia-Pacific

<https://ecb.omron.com.sg/>

Korea

<https://www.omron-ecb.co.kr/>

Europe

<http://components.omron.eu/>

China

<https://www.ecb.omron.com.cn/>

Japan

<https://www.omron.co.jp/ecb/>