Effective November 2020

Internal construction

All Kearney fuse links are designed with low melting temperature element components of either tin or solder filled dual element construction. Each element material shipment from our supplier is accompanied with a certification of quality and composition. The diameter is verified in incoming inspection. Low melting temperature fuse links Types K, T, 200, X and KS have exceptional overload capability. They are designed to carry 150% of their continuous current rating continuously without damage to the fuse link itself or to the cutout fuseholder in which they are installed. (Care should be exercised so that the current rating of the cutout is not exceeded.)

Tin element

Links using pure tin elements have a precision gauged strain wire crimped in parallel to provide tension loading properties. The tin element is soldered into position providing the industry's best possible electrical connection between the element and its terminals. The low melting temperature of the tin allows all of the fuse link components to operate at a lower temperature while providing long term reliable TCC.

Dual element

There are two dual element designs. The dual element design for 1 and 2 A K, KS, X, T, 200 (N), QA, and SQ 0.2 A - 1.45 A link assemblies is composed of a heater coil mounted around a solder pot that is soldered to a fuse element. Types KS and X links above 2 A and SQ links above 1.4 A have two wire elements in series which are axially inserted into a soldered coil.

Dual element links which use solder coils are mechanically crimped to the body and screw terminals. The elements are inserted into the coil and meticulously gauged to assure that active element lengths are maintained. The soldering process then permanently sets the active elements to the proper TCC curve and guarantees positive electrical continuity.

Dual elements allow the fuse to respond as low temperature single element fuses for long time overloads, yet have superior lightning surge withstand capability. Both types of links have up to 26 times more surge withstand capability than single element fuse links.

Final construction

After passing in-process QA checks, high strength color coded tubes are swaged to both the single and dual element fuse links. A unique self locking washer and button is attached to the screw terminal. Every fuse link is axial pull tested to verify mechanical strength before packaging in the Kearney unique "lineman friendly" pull-tab fuse packs.

Fuse link selection

Type K (tube color brown)

Kearney Type K fuse links have been tested to the IEEE Std C37.42[™] standard requirements for a "fast" fuse. The nominal speed ratio of Type K fuse links is 7. Type K fuse links are well suited where "fast" time-current characteristics are desired such as for capacitor protection.

Type 200 (N) (tube color green)

Kearney Type 200 fuse links are classified as "medium" speed fuses, with a nominal speed ratio of 10. Type 200 fuse links provide more surge withstand capability than Type K links, and provide good coordination possibilities with relays and reclosers.

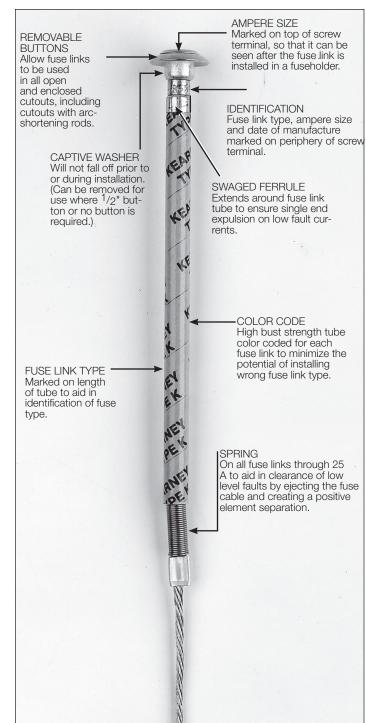


Figure 1. Fuse link features.

Type QA (tube color yellow)

Kearney Type QA fuse links are classified as "medium" speed fuse links with a nominal speed ratio of 10. Type QA fuse links will carry 100% of the rated current continuously without damage, and provide good coordination possibilities with relays and reclosers.

Kearney fuse links

Type T (tube color white)

Kearney Type T fuse links have been tested to the IEEE Std C37.42[™] standard requirements for a "slow" fuse link. The nominal speed ratio of Type T fuse links is 12. Type T fuse links provide slower timecurrent characteristics than Types K, 200, and QA, and coordinate well with relays and reclosers.

Type KS (tube color light-blue)

Kearney Type KS fuse links employ dual element construction which gives the Type KS high surge withstand capability, and a nominal speed ratio of 20. Classified as "very slow" fuse links, the Type KS has greater surge current withstand capability than the Type T, and is a good choice for line fusing and transformer protection.

Type X (tube color orange) and Type SQ (tube color brown)

Kearney Type X and SQ fuse links are specially designed for transformer protection. Type X and SQ fuse links employ dual element construction, which allows the time- current characteristic to be carefully shaped to closely match the IEEE Std C57.91[™] standard loading curve for transformers while providing excellent surge withstand to avoid nuisance blowing from lightning and switching surges. The nominal speed ratio of the Type X and SQ fuse links is 32.

Packaging

All fuse links are packed in individual cartons for the maximum protection and ease of use. Cartons are perforated for easy opening. Fuse links can be removed with gloves on. Fuse Link Type and Ampere Ratings are clearly marked on the carton. The print will not smear or run.

Five Pack Sleeves: Fuse Link Type and Ampere Rating are clearly marked on box front and end of cartons. Individual cartons are tabbed so that remaining fuses stay securely in the carton as others are removed.

Overcartons: All fuse links 100 A and below are packed in protective overcartons 25 per box. Catalog Number, Fuse Link Type, Ampere Rating, and Date of Manufacture are marked on the label for ease of selection.

Note: SQ links are individually packaged in transparent plastic bags. Bagged fuses are packed in an overcarton for protection and ease of handling. The catalog number, fuse type and amp rating are clearly marked on each bag and on all cartons.

Comparative melting speed ratio chart

Electrical equipment such as transformers, switches, relays, and conductors are exposed to various levels of current during normal operation. Generally, electrical devices can withstand high currents for a short period of time and low current for longer periods of time without thermal or mechanical damage. The ability to withstand various levels of current for various periods of time is referred to as time-current characteristics.

Coordination of power systems involves the selection of fuse links to protect equipment with various time-current characteristics while coordinating with reclosers, circuit breakers, sectionalizers, relays, and other fuses. Kearney offers six types of fuse links with a wide range of time-current characteristics (refer to Table 1).

The speed ratio of all fuse link sizes 100 A and below is the ratio between the current that melts the fuse in 0.1 seconds to the current that melts the fuse in 300 seconds. The higher the ratio, the slower the speed of melting. For fuses rated above 100 A, the speed ratio is between the melting currents at 0.1 second and 600 seconds.

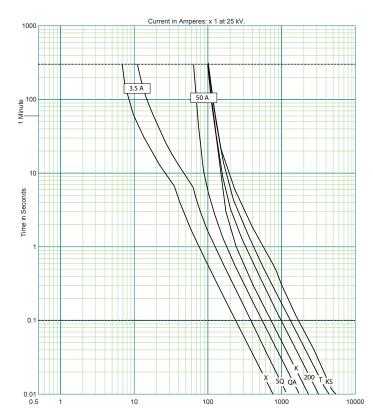


Figure 2. This chart compares the six speed ratios available with standard fuse link types which are fully adaptable to various coordination needs.

Table 1. Speed Ratio

	Tin Element(s) Slow T		Dual Element		nt
Designation	Fast	Medium	Slow	Very Slow	Extra Slow
Туре	К	200, QA	Т	KS	X, SQ
Speed Ratio	6-8	7-11	10-13	20	32

Ordering information

Table 2. Fit-All[™] Fuse Link Ordering Information

Current Rating	Туре Х	Type SQ	Type KS	Туре 200	Type QA	Туре К	Туре Т
0.2	-	02SQ-60	-	_	-	_	-
0.3	-	03SQ-60	-	_	-		-
0.33	41033CPS		-	_	-	_	-
0.4	_	04SQ-60	-	_	-	_	-
0.5	41050CPS	_	-	_	-	_	_
0.6	_	06SQ-60	-	_	-	_	_
0.7	-	07SQ-60	-	_	-	_	_
0.75	41075	_	-	_	-		-
1	41100CPS	10SQ-60	21001	11001	6413-2T	31001	51001CPS
1.25	41125	_	_	_	_	_	_
1.3	_	13SQ-60	-	_	-	_	_
1.4	-	14SQ-60	-	_	-	_	_
1.5	41150CPS	_	-	_	-	_	-
1.6	_	16SQ-60	_	_	_	_	_
2	41200	_	21002	11002	6414-2T	31002CPS	51002
2.1	_	21SQ-60	_	_	_	_	_
2.5	41250CPS	_	-	_	-	_	_
2.75	41275CPS	_	_	_	_	_	_
3	-	_	21003	11003	6415-2T	31003CPS	51003
3.1	_	31SQ-60	_	_	—	_	_
3.5	41350	35SQ-60	-	_	_	_	_
4	41400	-	-	_	_	_	_
4.2		42SQ-60	_	_	_	_	
5	_	-2002 00	21005	11005	6416-2T	31005	51005CPS
5.2			21003		0410-21		51005015
5.5	41550	_		_	_	_	
6	41000	_	21006	_		31006	51006
6.3	-				_	31000	
7				11007	— 6417-2T	31007	51007
7.8	41007013	70SQ-60 78SQ-60	21007	11007	0417-21	31007	51007
7.0 8	-	7030-00	-	11000		31008	
10		_		11008 11010	6417-8-2T 6418-2T	31008	51008CPS 51010CPS
10.4	41010013		21010013	11010	0410-21	31010	51010013
10.4		10430-00	-	_		31012	51012
12					-	31012	51012
15		14030-00	21015	11015		31015	51015
20	41010CF3	_	21015	11015	6420-2T	31020CPS	51020CPS
20	-		21020	11020	0420-21	31020013	31020013
25	_	21030-00	21025	11025			51025
30	-	_	21023	11025	6422-2T	31023CF3	51025 51030CPS
32			21030		0422-21		51050015
40		52030-00	21040				
46				-			51040013
50		40030-00		11050			
60			_	-	6425-2T		51050013
		_		11065			
65 75	_	_	21065	11065 11075	— 6426-2T	31000053	010000F3
	-	_			0420-21	21000000	
80 85	-	_	21080025	11080 11085	-	31080CPS	51080CPS
100	_	_		11100			51100
125	-	-	21100025	11125	6427-21 6428-2T	31100045	51100
125	-	-	21120	11120	U420-21	211/0	
		-	-			31140	· · · ·
150	-	-	21150CPS	11150	6429-2T	-	-
175	-	_		11175	6724-2T	-	— 51200
200	_	_	21200CPS	11200	6725-2T	31200	51200

Notes:

Downloaded from Arrow.com.


- Fit-All fuse links listed above have removable button heads. For non-removable button heads add "A" in front of the part number. Exceptions: Non-removable button heads are not available for Types X, SQ, QA links or 125 A, 150 A and 200 A Type 200 links.
- Fit-All fuse links listed above are all 23" (584 mm) long. For 26" (660 mm) long fuses links add -29, except the SQ links. For SQ links replace -60 with -26.

Current Rating	Туре Х	Type KS	Туре 200	Туре QA	Туре К	Type T
.33	42033	_	—	-	_	—
.50	42050	_	_	_	_	-
.75	42075	—	_	—	—	—
1.00	42100	22001	12001	6813	32001	52001
1.25	42125	—	—	-	_	—
1.50	42150	_	_	_	_	_
2	42200	22002	12002	6814	32002	52002
2.50	42250	_	_	_	_	_
2.75	42275	_	_	_	_	_
3	_	22003	12003	6815	32003	52003
3.50	42350	_	_	_	_	_
4	42400	-	_	_	_	_
5	_	22005	12005	6816	_	_
5.50	42550	_	_	_	_	_
6	_	_	_	_	32006	52006
7	42007	22007	12007	6817	_	_
8	_	_	_	_	32008	52008
10	42010	22010	12010	6818	32010	52010
12	_	_	_	_	32012	52012
15	42015	22015	12015	6819	32015	52015
20	_	22020	12020	6820	32020	52020
25	_	22025	12025	6821	32025	52025
30	_	22030	12030	7482	32030	52030
40	_	22040	12040	7483	32040	52040
50	_	22050	12050	7484	32050	52050

Table 4. Fit-All Fuse Link Dimensions

Current Rating (A)	Fuse Link Types	A* Inches (mm)	B* Inches (mm)	C* Inches (mm)	D* Inches (mm)	F* Inches (mm)	L* Inches (mm)
.50 to 2	X, KS, T, K, 200, QA	.50 (13)	.75 (19)	5.38 (137)	.27 (6.8)	1.13 (29)	23.00 (584)
2.50 to 15	Х	.50 (13)	.75 (19)	5.38 (137)	.31 (7.7)	1.13 (29)	23.00 (584)
3 to 20	К	.50 (13)	.75 (19)	5.38 (137)	.31 (7.7)	1.13 (29)	23.00 (584)
3 to 25	200, QA, KS, T	.50 (13)	.75 (19)	5.38 (137)	.31 (7.7)	1.13 (29)	23.00 (584)
.2 to 1.4	SQ	.50 (13)	.75 (19)	5.38 (137)	.27 (6.8)	N/A	23.00 (584)
1.6 to 42	SQ	.50 (13)	.75 (19)	5.38 (137)	.31 (7.7)	N/A	23.00 (584)
25 to 50	К	.50 (13)	.75 (19)	5.38 (137)	.31 (7.7)	N/A	23.00 (584)
30 to 50	T, KS, 200	.50 (13)	.75 (19)	5.38 (137)	.31 (7.7)	N/A	23.00 (584)
30 to 60	QA	.50 (13)	.75 (19)	5.38 (137)	.31 (7.7)	N/A	23.00 (584)
65 to 100	K, T, KS, 200	-	.75 (19)	5.38 (137)	.40 (10)	N/A	23.00 (584)
75 to 150	QA	-	.75 (19)	5.38 (137)	.40 (10)	N/A	23.00 (584)
125 to 200	KS, 200	-	1 (25)	6.38 (162)	.50 (13)	N/A	23.00 (584)
140 to 200	K,T	-	1 (25)	6.38 (162)	.50 (13)	N/A	23.00 (584)
175 to 200	QA	_	1 (25)	6.38 (162)	.50 (13)	N/A	23.00 (584)

*See Figure 4

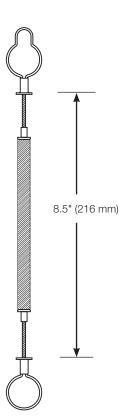

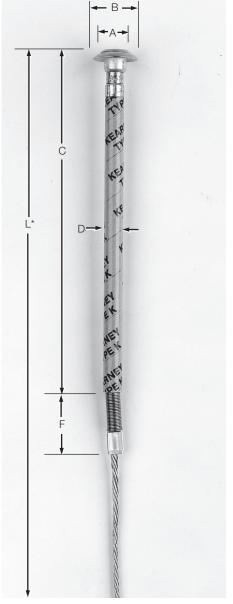



Figure 4. Fit-All fuse links.


* "L" dimension extends to the end of the fuse leader.

Figure 3. Trip-O-Link fuse links.

Indicating type tubular secondary fuses

Indicating type tubular secondary fuses protect transformers and capacitors from secondary overloads and faults. Each secondary fuse has a spring locked red plastic flag which springs out from the cartridge when the fuse link melts, indicating an outage. Fuses are available with insulated or non-insulated leads.

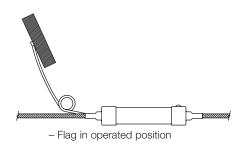



- Flag in operational position

Figure 5. Tubular secondary fuses.

Table 5. Ordering Information for Indicating Type Tubular Secondary Fuses

Current Rating (A)	Tinned Leads	Insulated Leads
10	8316	8316-5
15	8317	8317-5
20	8318	8318-5
25	8319	8319-5
30	8320	8320-5
40	8321	8321-5
50	8322	8322-5
60	8323	8323-5
75	8324	8324-5
100	8325	8325-5
125	8326	8326-5
150	8327	_
175	8328	_
200	8329	_
300	11405	_

Universal adapter assemblies

This universal adapter assembly will adapt Fit-AllTM fuse links for use in the cutouts that have bolt-type cable connections to connect the upper as well as the lower cable. Note from the table that only five sizes are required to adapt to any type fuse.



Figure 6. Universal Adapter assemblies.

Table 6. U-Adapter Assemblies*

For Types KS, X, K, T and 200 Fuses

Current Rating (A)	Catalog Number		
0.33-25	14036		
30-50	14036-1		
65-100	14036-2		
125-150	14036-3		
175-200	14036-4		

* 10" length for all ampere ratings

Table 7. U-Adapter Assemblies*

For Type QA Fuse

Tor type an tuse			
Current Rating (A)	Catalog Number		
1-25	14037		
30-50	14037-1		
60-100	14037-2		
125-150	14037-3		
175-200	14037-4		

* 10" length for all ampere ratings

Additional Information

Refer to the following literature for more information.

K-21000 ABKearney Type KS Time Current Characteristic CurvesK-31000 ABKearney Type K Time Current Characteristic CurvesK-41000 ABKearney Type X Time Current Characteristic CurvesK-51000 ABKearney Type T Time Current Characteristic CurvesK-5010-32 ABKearney Type QA Time Current Characteristic CurvesK-6010-32 ABKearney Type QA Time Current Characteristic CurvesK-50 ABKearney Type S0 Time Current Characteristic CurvesTD132007ENTin vs. Silver Links (PD Update No. 5)R327-40-3Kearney Fuse Links-Coordination Chart for Type 200LinksLinksR327-40-4Kearney Fuse Links-Coordination Chart for Type GA FLinksLinksR327-40-5Kearney Fuse Links-Coordination Chart for Type T FusLinksKaarney Fuse Links-Coordination Chart for Type T FusLinksKaarney Fuse Links-Coordination Chart for Type T KitR327-40-6Kearney Fuse Links-Coordination Chart for Type N (20)R327-40-7Kearney Fuse Links-Coordination Chart for Type N (20)R327-40-8Kearney Fuse LinksR327-40-9Kearney Fuse Links-Coordination Chart for Type KS VR327-40-10Kearney Fuse LinksR327-40-10Kearney Fuse Links-Coordination Chart for Type K VR327-40-11Kearney Fuse Links		
K-31000 ABKearney Type K Time Current Characteristic CurvesK-41000 ABKearney Type X Time Current Characteristic CurvesK-51000 ABKearney Type OA Time Current Characteristic CurvesK-51000 ABKearney Type QA Time Current Characteristic CurvesK-6010-32 ABKearney Type QA Time Current Characteristic CurvesK-6010-32 ABKearney Type SQ Time Current Characteristic CurvesK-SQ ABKearney Type SQ Time Current Characteristic CurvesTD132007ENTin vs. Silver Links (PD Update No. 5)R327-40-3Kearney Fuse Links-Coordination Chart for Type 200LinksKearney Fuse Links-Coordination Chart for Type AS FR327-40-4Kearney Fuse Links-Coordination Chart for Type AS FR327-40-5Kearney Fuse Links-Coordination Chart for Type T FuseLinksKarney Fuse LinksR327-40-6Kearney Fuse Links-Coordination Chart for Type T with Type X Fuse LinksR327-40-7Kearney Fuse Links-Coordination Chart for Type N (21)R327-40-9Kearney Fuse Links-Coordination Chart for Type N (21)R327-40-10Kearney Fuse Links-Coordination Chart for Type K with Type X Fuse LinksR327-40-10Kearney Fuse Links-Coordination Chart for Type K with Type X Fuse LinksR327-40-10Kearney Fuse Links-Coordination Chart for Type K with Type X Fuse LinksR327-40-11Kearney Fuse Links-Coordination Chart for Type A with Type X Fuse Links	K-11000 AB	Kearney Type N (200) Time Current Characteristic Curves
K-41000 ABKearney Type X Time Current Characteristic CurvesK-41000 ABKearney Type T Time Current Characteristic CurvesK-51000 ABKearney Type QA Time Current Characteristic CurvesK-6010-32 ABKearney Type QA Time Current Characteristic CurvesK-6010-32 ABKearney Type SQ Time Current Characteristic CurvesK-50 ABKearney Type SQ Time Current Characteristic CurvesTD132007ENTin vs. Silver Links (PD Update No. 5)R327-40-3Kearney Fuse Links-Coordination Chart for Type 200LinksKaarney Fuse Links-Coordination Chart for Type KS FR327-40-4Kearney Fuse Links-Coordination Chart for Type QA FLinksKaarney Fuse Links-Coordination Chart for Type T FusR327-40-5Kearney Fuse Links-Coordination Chart for Type T FusR327-40-6Kearney Fuse Links-Coordination Chart for Type T FusR327-40-7Kearney Fuse Links-Coordination Chart for Type N (20)R327-40-8Kearney Fuse LinksR327-40-9Kearney Fuse Links-Coordination Chart for Type N (20)R327-40-9Kearney Fuse LinksR327-40-10Kearney Fuse Links-Coordination Chart for Type K wiR327-40-10Kearney Fuse LinksR327-40-11Kearney Fuse Links-Coordination Chart for Type K wiR327-40-11Kearney Fuse Links-Coordination Chart for Type A wi	K-21000 AB	Kearney Type KS Time Current Characteristic Curves
K-51000 ABKearney Type T Time Current Characteristic CurvesK-6010-32 ABKearney Type QA Time Current Characteristic CurvesK-6010-32 ABKearney Type SQ Time Current Characteristic CurvesK-SQ ABKearney Type SQ Time Current Characteristic CurvesTD132007ENTin vs. Silver Links (PD Update No. 5)R327-40-3Kearney Fuse Links-Coordination Chart for Type 200LinksKarney Fuse Links-Coordination Chart for Type KS FR327-40-4Kearney Fuse Links-Coordination Chart for Type QA FLinksKarney Fuse Links-Coordination Chart for Type T FuseR327-40-6Kearney Fuse Links-Coordination Chart for Type T FuseR327-40-7Kearney Fuse Links-Coordination Chart for Type N (20)R327-40-8Kearney Fuse Links-Coordination Chart for Type N (20)R327-40-9Kearney Fuse LinksR327-40-10Kearney Fuse Links-Coordination Chart for Type K wiR327-40-10Kearney Fuse LinksR327-40-11Kearney Fuse Links	K-31000 AB	Kearney Type K Time Current Characteristic Curves
Kearney Type QA Time Current Characteristic CurvesK-6010-32 ABKearney Type QA Time Current Characteristic CurvesK-SQ ABKearney Type SQ Time Current Characteristic CurvesTD132007ENTin vs. Silver Links (PD Update No. 5)R327-40-3Kearney Fuse Links-Coordination Chart for Type 200LinksKearney Fuse Links-Coordination Chart for Type KS FR327-40-4Kearney Fuse Links-Coordination Chart for Type QA FLinksKarney Fuse Links-Coordination Chart for Type QA FR327-40-5Kearney Fuse Links-Coordination Chart for Type T FusLinksKarney Fuse Links-Coordination Chart for Type T FusR327-40-6Kearney Fuse Links-Coordination Chart for Type T witR327-40-7Kearney Fuse Links-Coordination Chart for Type N (2000)R327-40-8Kearney Fuse Links-Coordination Chart for Type N (2000)R327-40-9Kearney Fuse LinksR327-40-10Kearney Fuse Links-Coordination Chart for Type K witR327-40-10Kearney Fuse Links-Coordination Chart for Type K witR327-40-11Kearney Fuse Links-Coordination Chart for Type K wit	K-41000 AB	Kearney Type X Time Current Characteristic Curves
K-SQ ABKearney Type SQ Time Current Characteristic CurvesTD132007ENTin vs. Silver Links (PD Update No. 5)R327-40-3Kearney Fuse Links-Coordination Chart for Type 200 LinksR327-40-4Kearney Fuse Links-Coordination Chart for Type KS F LinksR327-40-5Kearney Fuse Links-Coordination Chart for Type QA F LinksR327-40-6Kearney Fuse Links-Coordination Chart for Type T Fus LinksR327-40-6Kearney Fuse Links-Coordination Chart for Type T Fus LinksR327-40-7Kearney Fuse Links-Coordination Chart for Type T wi Type X Fuse LinksR327-40-8Kearney Fuse Links-Coordination Chart for Type N (21 with Type X Fuse LinksR327-40-9Kearney Fuse Links-Coordination Chart for Type KS w Type X Fuse LinksR327-40-10Kearney Fuse Links-Coordination Chart for Type K wi Type X Fuse LinksR327-40-11Kearney Fuse Links-Coordination Chart for Type K wi Type X Fuse Links	K-51000 AB	Kearney Type T Time Current Characteristic Curves
TOT 32007ENTin vs. Silver Links (PD Update No. 5)R327-40-3Kearney Fuse Links-Coordination Chart for Type 200 LinksR327-40-4Kearney Fuse Links-Coordination Chart for Type KS F LinksR327-40-5Kearney Fuse Links-Coordination Chart for Type QA F LinksR327-40-6Kearney Fuse Links-Coordination Chart for Type T Fus LinksR327-40-7Kearney Fuse Links-Coordination Chart for Type T wi Type X Fuse LinksR327-40-8Kearney Fuse Links-Coordination Chart for Type N (20 with Type X Fuse LinksR327-40-9Kearney Fuse Links-Coordination Chart for Type N (20 with Type X Fuse LinksR327-40-10Kearney Fuse Links-Coordination Chart for Type K wi Type X Fuse LinksR327-40-10Kearney Fuse Links-Coordination Chart for Type K wi Type X Fuse LinksR327-40-11Kearney Fuse Links-Coordination Chart for Type K wi Type X Fuse Links	K-6010-32 AB	Kearney Type QA Time Current Characteristic Curves
R327-40-3Kearney Fuse Links-Coordination Chart for Type 200 LinksR327-40-4Kearney Fuse Links-Coordination Chart for Type KS F LinksR327-40-5Kearney Fuse Links-Coordination Chart for Type QA F LinksR327-40-6Kearney Fuse Links-Coordination Chart for Type T Fus LinksR327-40-7Kearney Fuse Links-Coordination Chart for Type T wit Type X Fuse LinksR327-40-8Kearney Fuse Links-Coordination Chart for Type N (21 with Type X Fuse LinksR327-40-9Kearney Fuse Links-Coordination Chart for Type KS v Type X Fuse LinksR327-40-10Kearney Fuse Links-Coordination Chart for Type K wit Type X Fuse LinksR327-40-11Kearney Fuse Links-Coordination Chart for Type K wit Type X Fuse Links	K-SQ AB	Kearney Type SQ Time Current Characteristic Curves
LinksR327-40-4Kearney Fuse Links-Coordination Chart for Type KS F LinksR327-40-5Kearney Fuse Links-Coordination Chart for Type QA F LinksR327-40-6Kearney Fuse Links-Coordination Chart for Type T Fus LinksR327-40-7Kearney Fuse Links-Coordination Chart for Type T wi Type X Fuse LinksR327-40-8Kearney Fuse Links-Coordination Chart for Type N (21 with Type X Fuse LinksR327-40-9Kearney Fuse Links-Coordination Chart for Type N (21 with Type X Fuse LinksR327-40-10Kearney Fuse Links-Coordination Chart for Type K wi Type X Fuse LinksR327-40-10Kearney Fuse Links-Coordination Chart for Type K wi Type X Fuse LinksR327-40-11Kearney Fuse Links-Coordination Chart for Type K wi Type X Fuse Links	TD132007EN	Tin vs. Silver Links (PD Update No. 5)
LinksLinksR327-40-5Kearney Fuse Links-Coordination Chart for Type QA F LinksR327-40-6Kearney Fuse Links-Coordination Chart for Type T Fuse LinksR327-40-7Kearney Fuse Links-Coordination Chart for Type T with Type X Fuse LinksR327-40-8Kearney Fuse Links-Coordination Chart for Type N (20 with Type X Fuse LinksR327-40-9Kearney Fuse LinksR327-40-10Kearney Fuse LinksR327-40-10Kearney Fuse LinksR327-40-11Kearney Fuse LinksR327-40-11Kearney Fuse Links	R327-40-3	Kearney Fuse Links-Coordination Chart for Type 200 Fuse Links
Links R327-40-6 Kearney Fuse Links-Coordination Chart for Type T Fuse Links R327-40-7 Kearney Fuse Links-Coordination Chart for Type T with Type X Fuse Links R327-40-8 Kearney Fuse Links-Coordination Chart for Type N (20 with Type X Fuse Links) R327-40-9 Kearney Fuse Links-Coordination Chart for Type KS with Type X Fuse Links R327-40-9 Kearney Fuse Links-Coordination Chart for Type KS with Type X Fuse Links R327-40-10 Kearney Fuse Links-Coordination Chart for Type K with Type X Fuse Links R327-40-10 Kearney Fuse Links-Coordination Chart for Type K with Type X Fuse Links R327-40-11 Kearney Fuse Links-Coordination Chart for Type A with Type X Fuse Links	R327-40-4	Kearney Fuse Links-Coordination Chart for Type KS Fuse Links
R327-40-7 Kearney Fuse Links-Coordination Chart for Type T wi R327-40-8 Kearney Fuse Links-Coordination Chart for Type N (2) R327-40-9 Kearney Fuse Links-Coordination Chart for Type KS v R327-40-9 Kearney Fuse Links R327-40-10 Kearney Fuse Links-Coordination Chart for Type K wi R327-40-11 Kearney Fuse Links-Coordination Chart for Type Q v	R327-40-5	Kearney Fuse Links-Coordination Chart for Type QA Fuse Links
Type X Fuse Links Type X Fuse Links R327-40-8 Kearney Fuse Links-Coordination Chart for Type N (2) with Type X Fuse Links R327-40-9 Kearney Fuse Links-Coordination Chart for Type KS v Type X Fuse Links R327-40-10 Kearney Fuse Links-Coordination Chart for Type K wi Type X Fuse Links R327-40-11 Kearney Fuse Links-Coordination Chart for Type Q v	R327-40-6	Kearney Fuse Links-Coordination Chart for Type T Fuse Links
with Type X Fuse Links R327-40-9 Kearney Fuse Links-Coordination Chart for Type KS v Type X Fuse Links R327-40-10 Kearney Fuse Links R327-40-11 Kearney Fuse Links	R327-40-7	Kearney Fuse Links-Coordination Chart for Type T with Type X Fuse Links
Type X Fuse Links R327-40-10 Kearney Fuse Links-Coordination Chart for Type K wi Type X Fuse Links R327-40-11 Kearney Fuse Links-Coordination Chart for Type QA w	R327-40-8	Kearney Fuse Links-Coordination Chart for Type N (200) with Type X Fuse Links
Type X Fuse Links Y R327-40-11 Kearney Fuse Links-Coordination Chart for Type QA v	R327-40-9	Kearney Fuse Links-Coordination Chart for Type KS with Type X Fuse Links
	R327-40-10	Kearney Fuse Links-Coordination Chart for Type K with Type X Fuse Links
Type A ruse Elliks	R327-40-11	Kearney Fuse Links-Coordination Chart for Type QA with Type X Fuse Links
R327-40-12 Kearney Fuse Links-Coordination Chart for Type K Fu Links	R327-40-12	Kearney Fuse Links-Coordination Chart for Type K Fuse Links

Eaton 1000 Eaton Boulevard Cleveland, OH 44122 United States Eaton.com

Eaton's Power Systems Division 2300 Badger Drive Waukesha, WI 53188

United States Eaton.com/cooperpowerseries

© 2020 Eaton All Rights Reserved Printed in USA Publication No. CA132031EN November 2020

Eaton is a registered trademark.

All other trademarks are property of their respective owners.

For Eaton's Cooper Power series Kearney fuse link product information, call 1-877-277-47636 or visit: www.eaton.com/cooperpowerseries.

FAT•N

Powering Business Worldwide